

1998 Lexus LS400

Submodel: | Engine Type: V8 | Liters: 4.0
Fuel Delivery: FI | Fuel: GAS


DRP3-01

DTC	B2791/99	Key Unlock Warning SW OFF Malfunction
-----	----------	---------------------------------------

CIRCUIT DESCRIPTION

DTC No.	DTC Detecting Condition	Trouble Area
B2791/99	• Open circuit in key unlock warning switch circuit. • Key unlock warning switch adheres to OFF position.	• Key unlock warning switch • Wire harness

WIRING DIAGRAM

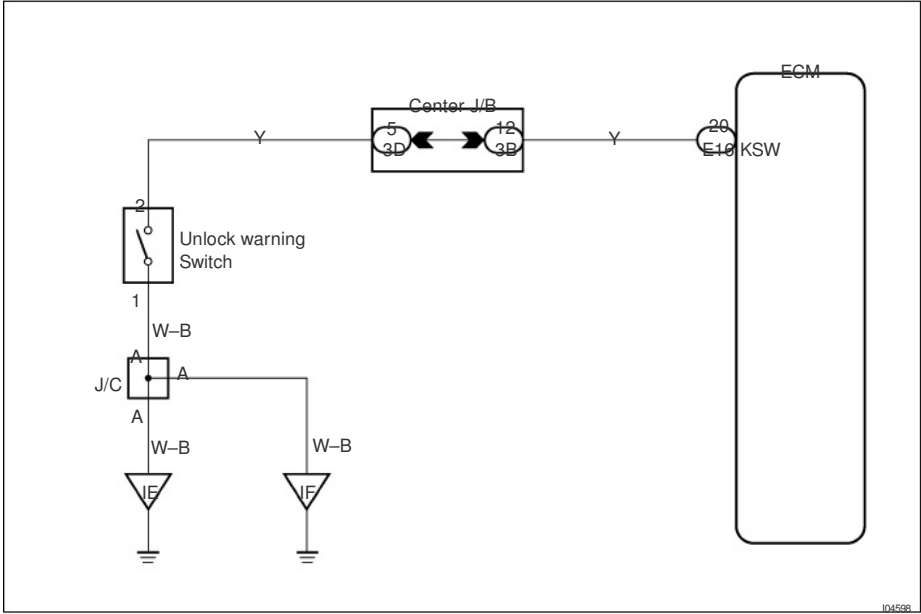

INSPECTION PROCEDURE

1

Check key unlock warning switch (See page [BE-33](#)).

NG

Replace key unlock warning switch.

OK

2

Check harness and connector between key unlock warning switch and ECM (See page [IN-30](#)).

NG

Repair or replace the harness or connector.

OK

Check and replace ECM (See page [IN-30](#)).