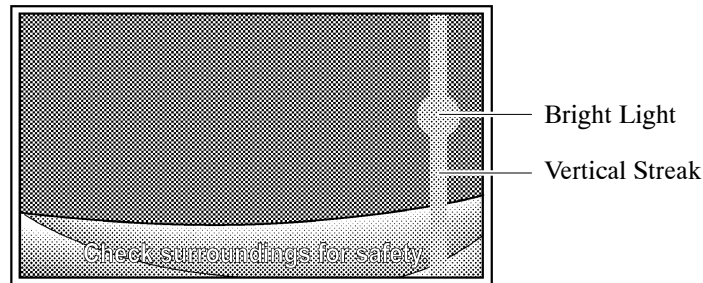


■ PRECAUTIONS FOR PARKING ASSIST MONITOR SYSTEM OPERATION

- In the following cases, it may become difficult to see items in the image on the screen, but this does not indicate a malfunction.
 - In the dark (for example, at night)
 - When the temperature near the lens is very high or low.
 - When water droplets are present on the television camera assembly, or when humidity is high. (for example, when it rains)
 - When foreign matter (for example, mud or salt) is present on the television camera assembly lens.
 - When the sun or the beam of headlights is shining directly into the television camera assembly lens.
- If a bright light (for example, sunlight reflected off the vehicle body) is picked up by the television camera assembly, the smear effect*, a phenomenon experienced by CCD cameras, may occur.

**Smear Effect**

241BE68

—REFERENCE—

*: *Smear effect*

A phenomenon that occurs when a bright light is received up by the television camera assembly. When transmitted to the screen, the light source will appear to have a vertical streak above and below it.