



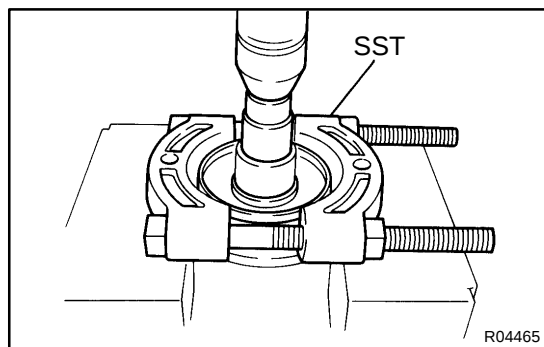

REPLACEMENT

1. REPLACE COMPANION FLANGE DUST DEFLECTOR, IF NECESSARY

- (a) Using SST and a press, remove the dust deflector.
SST 09950-00020

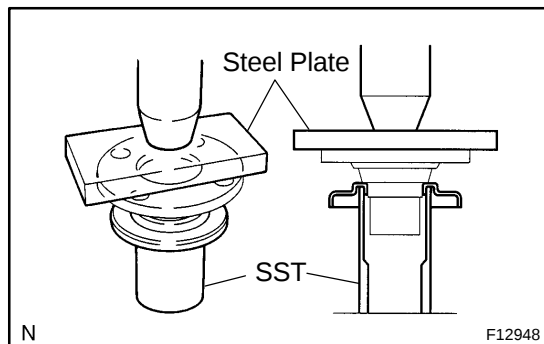


- (b) Using SST and a press, install a new dust deflector.

NOTICE:


SST 09710-04061

Do not deform the dust deflector.

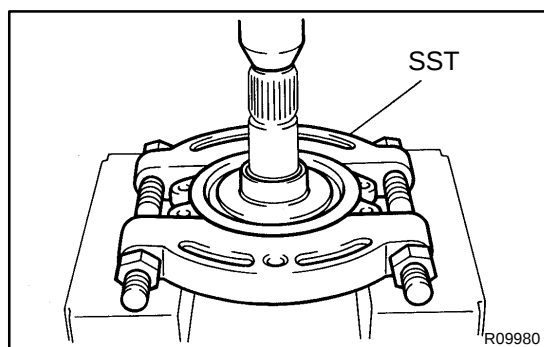

2. REPLACE SIDE GEAR SHAFT DUST COVER, IF NECESSARY

- (a) Using SST and a press, remove the dust cover.
SST 09950-00020

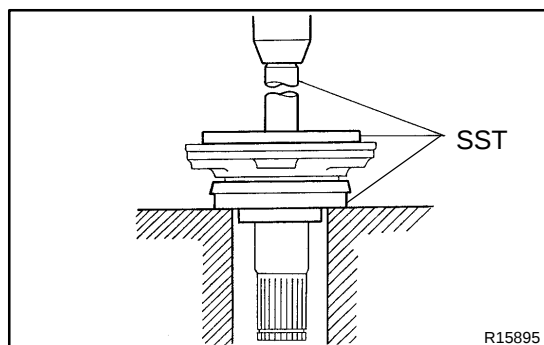

- (b) Using SST and a press, install a new dust cover.
SST 09502-24010, 09950-60020 (09951-00780),
09950-70010 (09950-07150)